



SERVICE BULLETIN

SUBJECT: REPLACEMENT OF DRIVE STEEL ROPES OF RADIAL ARMS.



As a safety precaution, BERTAZZON 3B srl requires all owners of Matterhorn rides manufactured by Bertazzon 3B amusement rides with the above noted serial numbers to perform the modification described within this bulletin. This modification will provide reduction risk of breaks of thimbles at the edge of the ropes. Clients may decide not to install the above safety kit at their sole own risk.

DESCRIPTION OF MODIFICATION REQUIREMENTS

All driving steel ropes (total q.ty 8 ropes) are to be replaced with the new ones. Each old roping (consisting of a steel rope, a clevis, a tightener and the related bolts and nuts) must be removed keeping the threaded piece of the tightener.

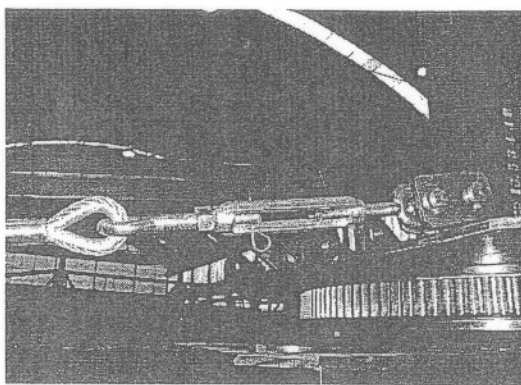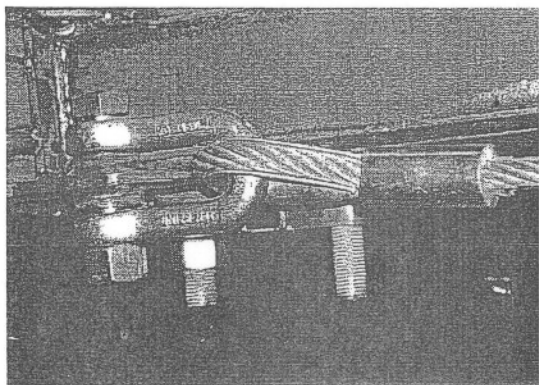

The new ropes shall be installed according to the following pictures:

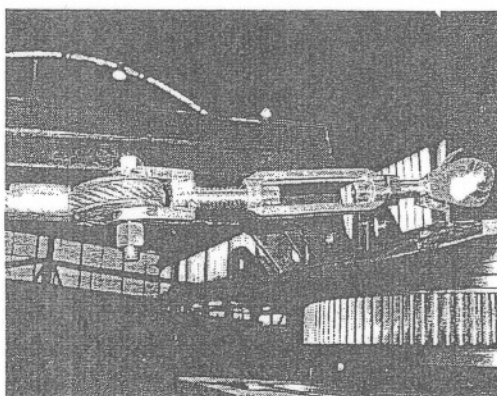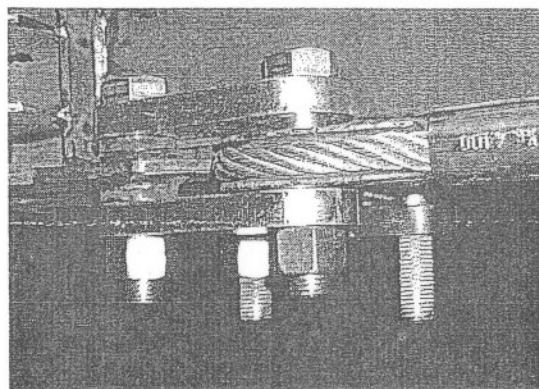

The tightener must be locked by two 4mm clips each after adjusting the ropes' tension.

New Driving steel ropes components list:

- No.8 ropes assembly (rope + tightener section + No.2 connection plates + M27x100 bolt + M27x122 bolt);
- No.8 central rotor tightener's section;
- No.8 M30x105 bolts (for tightener, center's side);
- No.8 M27x122 bolts (for arm's plates).



BERTAZZON
The Funworld's Proprietary