



NUMBER: B389R1085-0

DATE: NOV. 30, 1990

SUPERSEDES:

SERVICE BULLETIN

Effective Serial Number: 38901086 through 38902190 Chance Rides, Inc.
81-4806 through 85-4809
Chance Manufacturing Co., Inc.

Chance Rides, Inc. SPECIFICALLY DISCLAIMS ANY
LIABILITY for losses associated with rides
produced by Chance Manufacturing Company, Inc.

Ride: 50' CARROUSEL

Subject: Hydraulic Motor Cavitation

Chance Rides, Inc. has become aware of at least one 50' CARROUSEL amusement ride which has experienced cavitation to the hydraulic motor. A rework kit has been developed which when properly installed will help keep the motor supplied with oil. Chance Rides, Inc. requires all owners of the above noted rides to order and install kit number K389R1085-0 which contains all parts necessary to rework one ride.

PARTS LIST

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>
62743000	3/4" 90' Elbow	1
10000300	Hose	1
62777000	3/4" Close Nipple	2
62701800	3/4 to 1/2 Bushing Reducer	1
60036800	90 Degree Adapter	1
28440300	Check Valve	1
62702800	1" to 3/4" Bushing	1
K389R1085-0	Drawing	


The above noted, kit must be installed per the instructions which will accompany the kit and the attached Certification Of Compliance returned within 15 days after receipt of the kit.

All work must be performed by qualified personnel, capable of understanding the function of the parts and their proper installation.

NOTICE

Use only those components authorized, specified or provided by Chance Rides, Inc.

Chance Rides, Inc. SPECIFICALLY DISCLAIMS ANY LIABILITY for losses associated with any unauthorized alterations and/or modifications or additions and installations of unauthorized components.

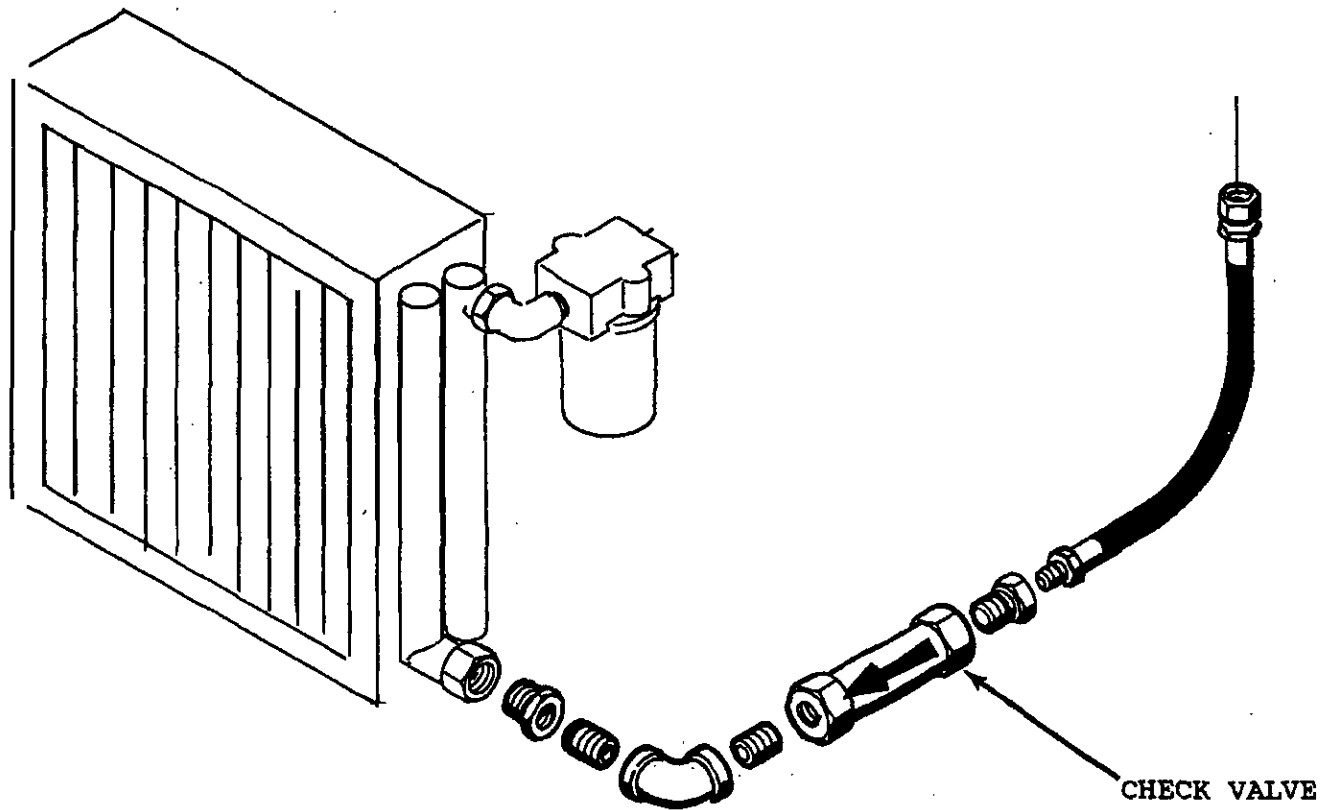

KIT 389R1085-0