



**ALLAN HERSCHELL**

**CHANCE**  
MANUFACTURING CO., INC.

Number: #77  
Date: 9-12-74

Superceeds:  
Number:  
Date:

## Service Information


Ride: YO YO                      Subject: GUSSET PLATE ADDITION  
SERIAL NUMBERS: 74-3300 THRU 74-3316, 74-3318

Because of a combination of factors, among them rough road conditions, one area of the YO YO trailer is receiving a higher degree of stress than was expected. This has resulted in the partial failure of the weld joints.

As soon as we receive the enclosed card from you, we will ship eight gusset plates which should be added to the trailer as shown.

It is important that these gusset plates be added even though your trailer presently shows no signs of fatiguing.

PART NUMBER	DESCRIPTION	NO. REQ'D.
376-550-133	Gusset Plate	8

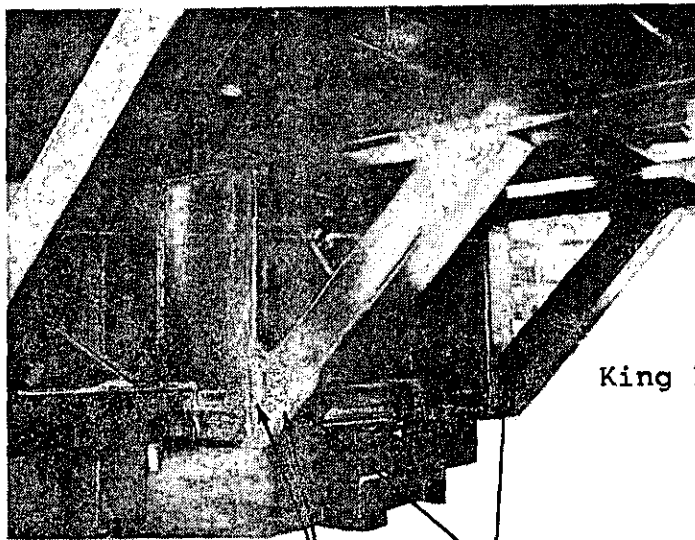

King Pin Section of Trailer

3/8 inch Fillet Weld-two sides-  
E70XX Rod

Weld gusset plates on both  
side of tube

Factory and General Office, 4219 Irving, Box 2397 Wichita, Kansas 67201

Area Code (316) 942-7411

Sales Office:

103 Ross Ave., Dallas, Texas 75202

Area Code (214) 742-3802