

ZAMPERLA INC.
49 Fanny Road
Parsippany, New Jersey 07054-6545
USA
Phone: 973 334 8133 Fax: 973 334 6880

Bulletin No: 99 SW1 REV
Release Date: 07/02/99
Effective Date: 07/02/99
Supersedes: 99 SW1
Completion Date: As soon as possible
Page: 1 of 2

SERVICE BULLETIN

Ride Manufacturer: Zamperla Inc.	Affected Production Dates: All
Ride Name: Speedway	Affected Serial Nos.: All
Model Number: Speedway	

Abstract Of Issue:
Cracks have been found in the bars that support the spring and connect the car to the chain. Specifically, the area where the threading on the shaft stops. See area indicated on the accompanying diagram.


Reason For Release:
Same.

Action To Be Taken:
Close visual control and dye penetrant testing by a certified NDT technician. (Rides that are new for the 1999 season may delay testing until next operating season.)

Detail Of Issue:
If cracks have been detected in the above mentioned areas and confirmed, please stop the ride and immediately contact Zamperla.

Future Action To Be Taken:
Close visual inspection and dye penetrant testing by a certified NDT technician annually.

CHAIN SIDE

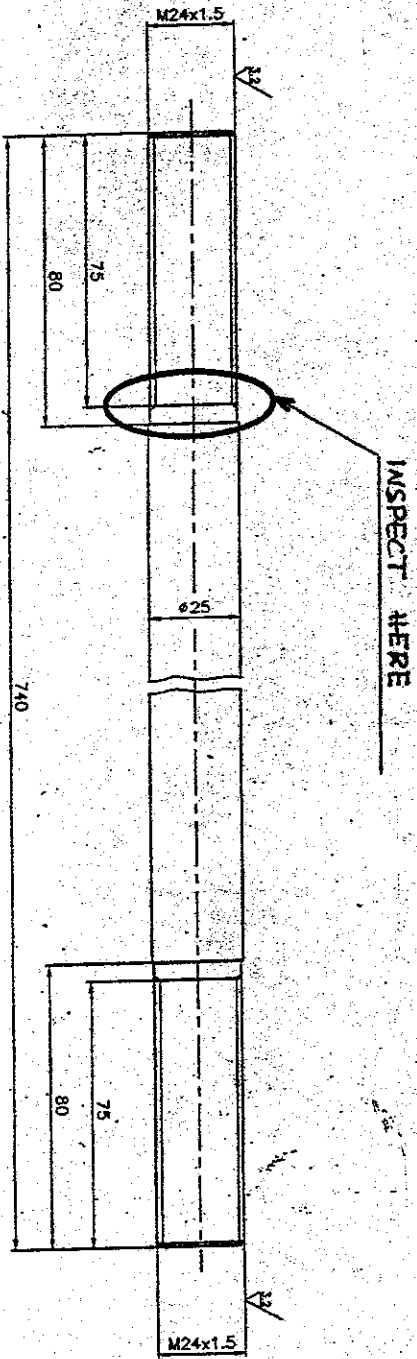

CHAIN SIDE

